

Specifications & Capacities


Rotary Cutters, Single Deck

RCR15 Series	
	RCR1542
Machine Weight (with Front Guard)	432#
Hitch	Category I
Cutting Width	42"
Overall Width	47 1/2"
Overall Length (Including Tailwheel)	85"
Deck Height (Bottom of Deck to Bottom of Skid Shoe)	7 1/4"
Cutting Height	1 3/4" - 11 1/2"
Cutting Capacity	Grass, weeds & light brush
Recommended Tractor HP	15-50 HP
PTO Speed	540 RPM
Gearbox Rating H.P	50 HP
Gearbox (Speed up beveled gears)	540 rpm PTO Driven Gearbox 1:1.93 Cast Iron Housing
Gearbox Lubrication	Gear Lube 80-90W EP
Deck Construction	One Piece Reinforced Deck
Deck Material Thickness	12 Gauge
Skids	1/4" X 2" Weld on
Stump Jumper	Round Pan 10 ga. x 24"
Blades (2)	1/2" x 3" Heat Treated Alloy Steel Free-Swinging Blades
Blade Bolts	Keyed with Harden Flat Washer and Lock Nut
Blade Tip Speed	11,459 fpm
Driveline	ASAE Category 3
Driveline Protection	Standard 1/2" Center Shearbolt protection Optional - Center Bolt 2 plate Slip Clutch
Tailwheel	4" x 16" Solid Rubber Tire
Safety Guards (Optional)	Rubber (front and rear)


Designs, specifications, features and information are subject to change without notice.

This web site is to be used as a guide for the matching of Land Pride Implements on Kubota Tractors in average conditions. Retail customers in conjunction with Kubota/Land pride dealers should use their best judgment to select the best combination of tractor size and implement capabilities. The mismatching of tractor and implements can result in the voiding of Kubota and/or Land Pride *Warranties*.

Rotary Cutters, Single Deck

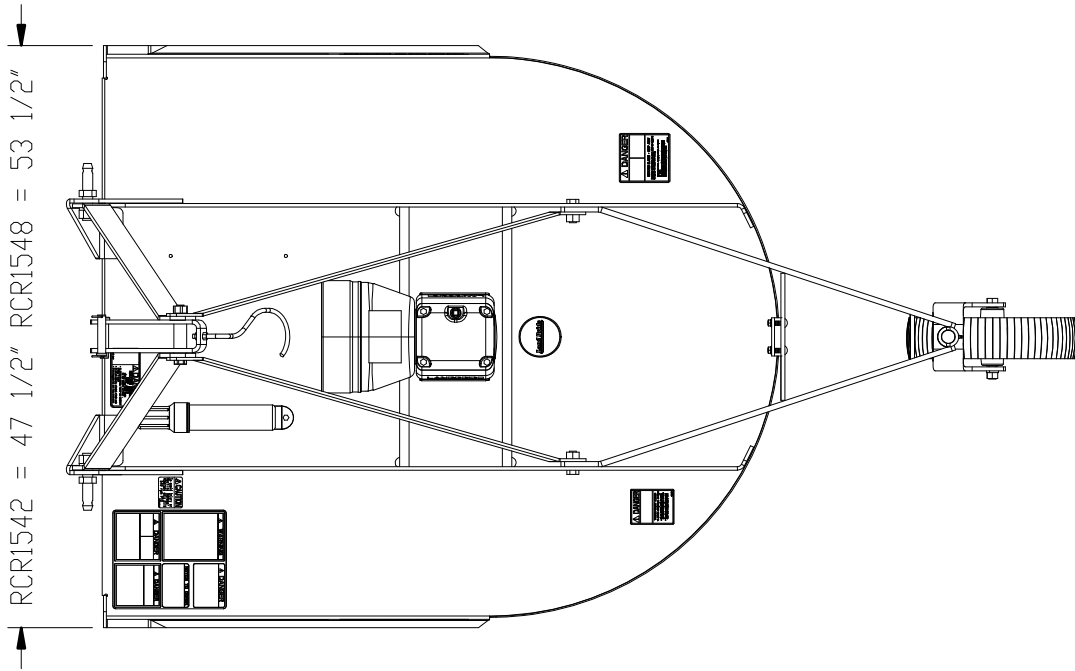

26813

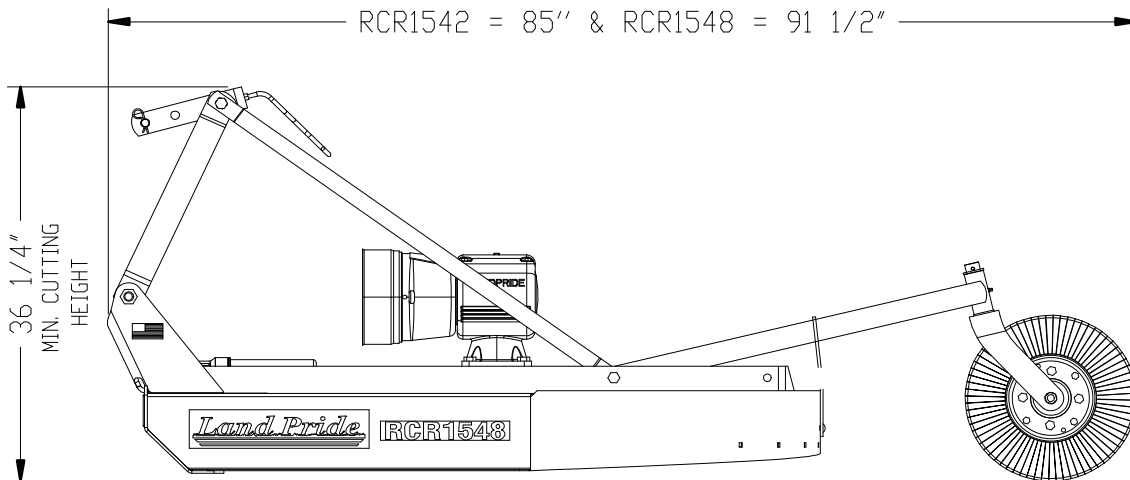

Designs, specifications, features and information are subject to change without notice. This web site is to be used as a guide for the matching of Land Pride Implements on Kubota Tractors in average conditions. Retail customers in conjunction with Kubota/Land pride dealers should use their best judgment to select the best combination of tractor size and implement capabilities. The mismatching of tractor and implements can result in the voiding of Kubota and/or Land Pride Warranties.

8/17/09